

Manhole Inspection Summary

Manhole # S19E__029MH

Printed On: 3/10/2009

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **19E** Node: **029** Status: **Found**

Insp Date: **10/10/07 1:41 PM**

Incomplete Comments

Crew: **ADS4**
Inspector: **ADS4**
Firm: **ADS**

Location Address: **2033 SARATOGUE-PENROSE**

Cross Street: **PULASKI ST**

Manhole Type: **Inline** Location: **Alley**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **1** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Flat top**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **52** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **0** Missing: **1** ☐ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S19E__029MH

Printed On: 3/10/2009

Page 2 of 3

Location View



Top View



Defect 3



MISSING STEP AND CORBEL WALL INFILTRATION

Defect 2



DETERIORATED CORBEL AND JOINT INFILTRATION

Defect 1



FRAME OFFSET

Manhole Inspection Summary

Manhole # S19E__029MH

Printed On: 3/10/2009

Page 3 of 3

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **7.2** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **8.52** (ft.) Flow Characteristics: **Fast**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**


Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow

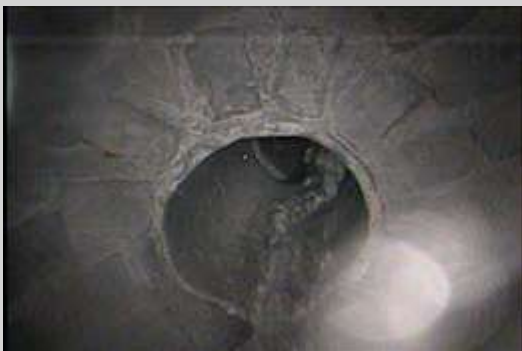

MISSING STEP AND CORBEL WALL
INFILTRATION

Pipe Height: **7.2** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **5.17** (ft.) Flow Characteristics: **Fast**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Broken**

Drop In @ 6 O'Clock



MISSING STEP AND CORBEL WALL
INFILTRATION

Drop: **Outside** Rod and Bar
Angled: **Yes** Reading: **7.32** (ft.)
Inv Depth: **8.32** (ft.)
Drop Condition: **Clogged**

Connects To: **Manhole**

☐ Possible Illicit Connection